

RCA Plu	RCA Plug		
MT380	MT380		
ne			
Prepared	Checked	Approved	
Received	Checked	Confirmed	
	MT380  Prepared	MT380  Prepared Checked	



Product Type	RCA Plug	e series and the series are the series and the series are the series and the series and the series are the seri
Product Number	MT380	

### **Product Features**

- Professional RCA plug, black plated housing, gold plated contact
- Used for transmitting digital audio signals and analog video signals
- > Good contact performance and stable signal transmission
- ➤ High-quality structural design and sophisticated manufacturing materials ensure the plug lifetime of 2000 cycles



#### **Electrical Parameters**

Item	Specification
Rated Voltage	< 50 V
Contact Resistance	subject on mating connector
Dielectric Strength	1500 V DC
Insulation Resistance	> 5 GΩ

### **Mechanical Parameters**

Item	Specification
Service Life	> 1000 mating cycles
Cable Size	1.5 mm <sup>2</sup> 16 AWG
Cable OD	3.5-6.5 mm



### **Material and Environmental Parameters**


Item	Specification
Housing	Zinc alloy
Contacts	Brass
Contact surface	Au
Housing Electroplating	Black plating
Temperature range	-30°C ~ +80°C

Standards and Certifications	
------------------------------	--

Solderability	IEC 68-2-20
---------------	-------------



### **Product Drawing**

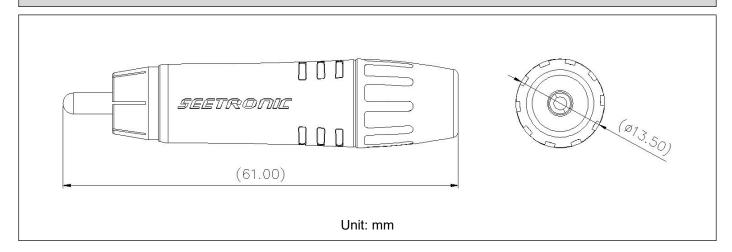

### **Packaging Method**

1 pc per bag (include 1 pc each of inner core assembly, housing, transparent insulating tube and boot) 100 pcs per inner carton, 5 inner cartons per master carton (500 pcs per master carton)


#### **Accessory**

- ☑ No accessories □ Back fastener plate
- □ Screws and Nuts □ Other




### **Assembly Instructions**


(1) Put the cable through the boot, housing and transparent insulating tube.

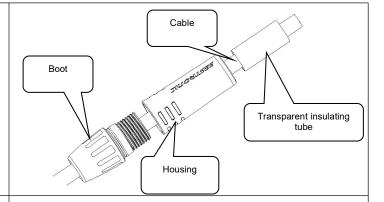

(2) Strip the cable in the size as shown.

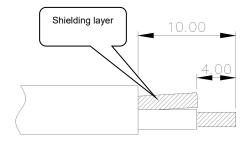

(3) Solder the conductor of the cable to the inner core assembly and secure the cable with the clamping plate.

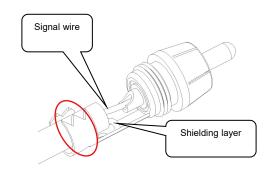

www.seetronic.com



### **Assembly Instructions**

(4) Slide the transparent insulating tube over the inner core assembly and tighten the housing clockwise to the inner core assembly.



(5) Finally, screw the boot into the housing and tighten in a clockwise direction.

